babcoparts
a division of babco sales ltd.

# Automotive Lift

REPAIR PARTS

## ROTARY

2 POST • A10i

# for lift model A10i

## doorjammerPRO

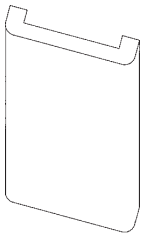

*Designed with this Rotary lift model in mind.*

For better all around vehicle protection nothing beats a doorjammerPRO. Install one today and put an end to the denting and dinging done to your customer's doors. Makes the service tech more ef ficient because it is easier to get in and out of vehicles. Don't be held accountable for dents and dings.

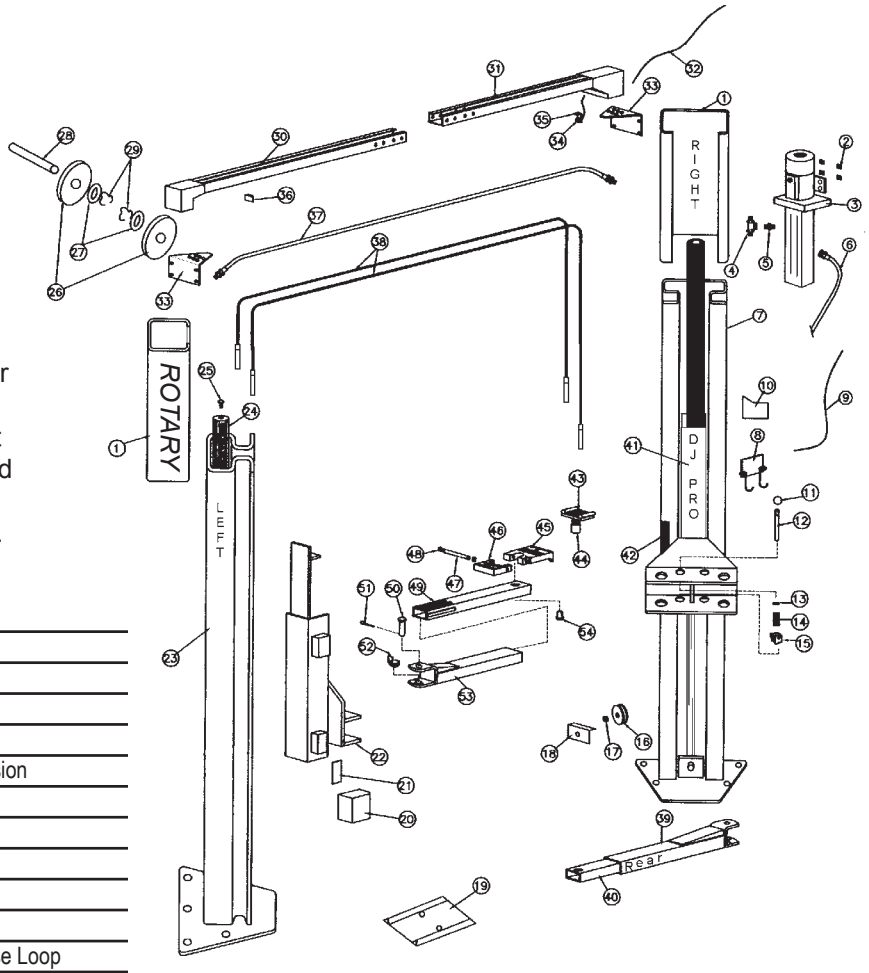


| Item | Part# | OEM# | Req | Description |
|---|---|---|---|---|
| 1 | call for details | | 2 | Column Extension |
| 2 | BH-7520-03 | P1164-3 | 4 | Vibration Dampener |
| 3 | call for details | P1364 | 1 | Power Unit 1Ø |
| 4 | BH-7519-21 | N331 | 1 | Tee |
| 5 | BH-7519-22 | N332 | 1 | O-Ring Fitting Extension |
| 6 | BH-7519-23 | N368 | 1 | Power Unit Hose |
| 7 | call for details | N750 | 1 | Right Column |
| 8 | BH-7500-93 | FA5162 | 1 | Air Tool Bracket |
| 9 | BH-7527-97 | FA7180-43 | 1 | Control Cable |
| 10 | BH-7509-91 | FA928 | 1 | Wiring Chase |
| 11 | BH-7508-20 | FJ7985-1 | 4 | Arm Restraint Release Loop |
| 12 | BH-7528-07 | N121-1 | 4 | Arm Restraint Pin |
| 13 | BH-7528-06 | N119-3 | 4 | Arm Restraint Retaining Pin |
| 14 | BH-7535-58 | FJ7656-2 | 4 | Arm Restraint Spring |
| 15 | BH-7545-17 | N2121 | 4 | Arm Restraint Engage Gear |
| 16 | BH-7530-01 | | 6 | Sheave, Steel |
| | BH-7530-01N | N377 | 6 | Sheave, Nylon |
| 17 | BH-7500-62A | 41411 | | Ext. Retaining Ring 5304-75 |
| 18 | BH-7502-33 | N119-1 | 2 | Debri Shield |
| 19 | BH-9701 | | 1 | 15" Wide Reach Wheel Spotter |
| | BH-9702 | | 1 | 15" Wide Reach Dual Spotter |
| 20 | BH-7510-03 | FJ7360 | 8 | Slider Block (cup style) |
| 21 | BH-7528-04 | N115 | | Slider Block Shim (as needed) |
| 22 | call for details | N822 | 2 | Carriage |
| 23 | call for details | N750 | 1 | Right Column |
| 24 | BH-7545-14 | N346 | 2 | Hydraulic Cylinder |
| 25 | call for details | | 2 | Bleeder Screw |
| 26 | BH-7530-01 | | 6 | Sheave, Steel |
| | BH-7530-01N | N377 | 6 | Sheave, Nylon |
| 27 | BH-7500-49B | 41388 | 4 | Spacer 1-1/2" x .045 thick |
| 28 | BH-7500-68 | FJ7444-8 | 2 | Sheave Shaft |
| 29 | BH-7500-62A | 41411 | | Ext. Retaining Ring 5304-75 |
| 30 | BH-7545-50 | N437-1 | 1 | Left Overhead Crossbeam |
| 31 | BH-7545-51 | N438-1 | 1 | Right Overhead Crossbeam |
| 32 | BH-7527-98 | FA7180-46 | 1 | Photosensor Extension Cable 2' |
| 33 | BH-7545-07 | N439 | 2 | Mounting Bracket |
| 34 | BH-7528-83 | N428 | 1 | Photosensor |
| 35 | BH-7528-84 | N428-1 | 1 | Photosensor Bracket |
| 36 | BH-7528-84A | N428-2 | 1 | Photosensor Reflector |
| 37 | BH-7519-24 | N369 | 1 | Overhead Hose |
| | BH-7519-25 | N371 | 1 | Overhead Hose (EH-1 & EH-2) |
| 38 | BH-7529-86 | N372 | 2 | Equalizer Cable |
| | BH-7529-92 | N378 | 2 | Equalizer Cable (EH-1) |
| | BH-7529-88 | N373 | 2 | Equalizer Cable (EH-2) |



*For all the carriage lock parts see index for "Two Post Carriage Locks"*

| Item | Part# | OEM# | Req | Description |
|---|---|---|---|---|
| 39 | BH-7545-38 | N2150-1 | 2 | Outer Rear Swing Arm |
| 40 | BH-7545-39 | N2150-2 | 2 | Inner Rear Swing Arm |
| | BH-7545-39C | N2103-1 | 2 | Inner Rear Swing Arm Kit |
| 41 | BH-7077-02-1 | | 1 | doorjammerPRO impact protection |
| 42 | BH-7077-01 | FJ7391-1 | 2 | doorjammerJR 18" cut-down strip |
| 43 | BH-7536-92P | FJ6158-4 | 4 | Rubber Pad only |
| 44 | BH-7536-96 | FJ6182 | 4 | Rubber Pad Adapter Base |
| 45 | BH-9755-20 | FJ6177 | 4 | High Step Ductile Iron Adapter |
| 46 | BH-9755-21 | FJ6178 | 4 | Low Step Ductile Iron Adapter |
| 47 | BH-7533-60 | FJ6179 | 4 | Adapter Pivot Pin |
| 48 | BH-9755-26 | FJ671-6 | 4 | Hog Ring Clip |
| 49 | BH-7545-40 | N2149-2 | 2 | Inner Front Swing Arm |
| | BH-7545-40C | N2156-1 | 2 | Inner Front Swing Arm Kit |
| 50 | BH-7545-54 | N2154 | 4 | Arm Swivel Pin |
| 51 | F-CP-187-2000 | 41250 | 4 | 3/16" x 2" Cotter Pin |
| 52 | BH-7545-16A | | 4 | Arm Restraint Gear (adjustable) |
| | BH-7545-16 | N2122 | 4 | Arm Restraint Gear (not adjustable) |
| 53 | BH-7545-41 | N2149-1 | 2 | Front Outer Swing Arm |

Titen HD's are removeable, which means you don't have to drill through the concrete or as deep.

For all your anchoring needs . . .

All names, numbers, symbols and descriptions are used for reference purposes only. It is not implied that any part listed is the product of these manufacturers; however, some parts may be the actual product of these manufacturers.

## Lock Parts for SPO10, SPOA10 & SPOA10NB

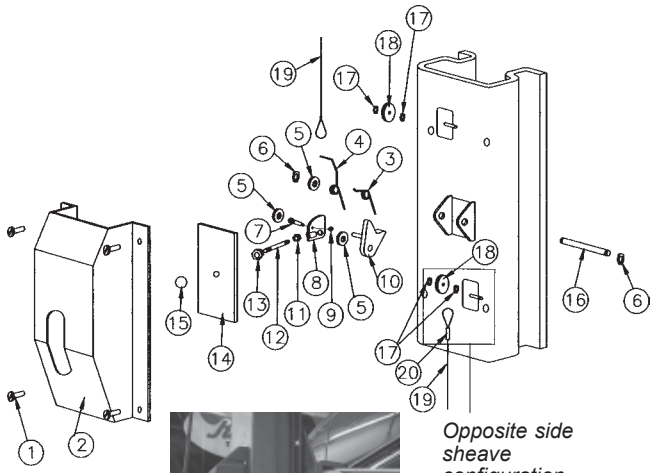

*Opposite side sheave configuration*

| Item | Part# | OEM # | Req | Description |
|---|---|---|---|---|
| 1 | F-MS-0312-18-0375 | | 4 | 5/16-18 x 3/8 Machine Screw |
| 2 | BH-7502-51 | FJ7452 | 1 | Main Side Cover (slotted) |
| | BH-7502-50 | FJ7451 | 1 | Opposite Side Cover (no slot) |
| 3 | BH-7503-16 | FJ7382-9 | 1 | Spring |
| 4 | BH-7503-31 | FJ7566-10 | 2 | Lock Latch Spring |
| 5 | BH-7500-49B | 41388 | 8 | 3/4" x 1-1/2" Bushing |
| 6 | BH-7500-62A | 41411 | 4 | Ext. Retaining Ring 5304-75 |
| 7 | F-SB-0312-20-1250 | 40220 | 2 | 5/16-20 X 1-1/4 Shoulder Bolt |
| 8 | BH-7503-40 | FJ7594-2 | 2 | Control Plate |
| 9 | F-LN-0250-20 | | 2 | 1/4-20 Lock Nut |
| 10 | BH-7519-66 | N616 | 2 | Lock Pawl |
| 11 | F-JN-0375-16 | | | 3/8-16 Jam Nut |
| 12 | BH-7503-17 | FJ7382-18 | 1 | Lock Release Handle |
| 13 | F-JN-0500-13 | | | 1/2-13 Jam Nut |
| 14 | BH-7519-61 | N617 | 1 | Cover |
| 15 | BH-7503-45 | FC134-91 | 1 | Red Ball |
| 16 | BH-7502-34 | FJ7382-34 | 2 | Lock Shaft |
| 17 | BH-7537-59B | 41410 | 4 | Ext. Retaining Ring 5304-37 |
| 18 | BH-7501-26 | FJ7322 | | Lock Cable Sheave |
| 19 | BH-7501-24 | FJ7595-1 | 1 | Locking Latch Release Cable |
| 20 | BH-7504-53 | N63-1 | | Cable Clamp |

## Lock Parts for A8i, A10i & S10i

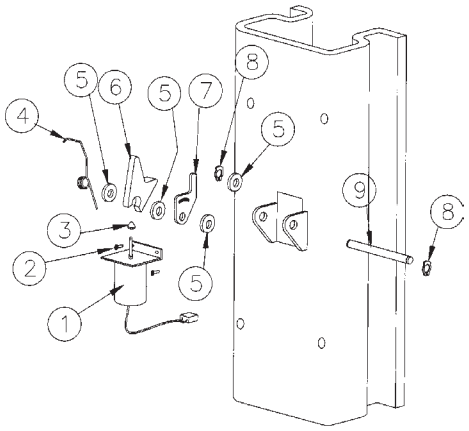

| Item | Part# | OEM # | Req | Description |
|---|---|---|---|---|
| 1 | BH-7519-62 | N613 | 1 | Lock Solenoid |
| 2 | F-MS-0312-18-0375 | | 2 | 5/16-18 x 3/8 Machine Screw |
| 3 | BH-7519-63 | N613-1 | 1 | Pivot |
| 4 | BH-7519-65 | N613-2 | 1 | Lock Spring |
| 5 | BH-7500-49B | 41388 | 4 | Spacer 1-1/2" x .045 thick |
| 6 | BH-7519-66 | N616 | 1 | Lock Pawl |
| 7 | BH-7519-64 | N613-3 | 1 | Control Plate |
| 8 | BH-7500-62A | 41411 | 2 | Ext. Retaining Ring 5304-75 |
| 9 | BH-7502-34 | FJ7382-34 | 1 | Lock Pawl Shaft |

## Lock Parts for SPO12

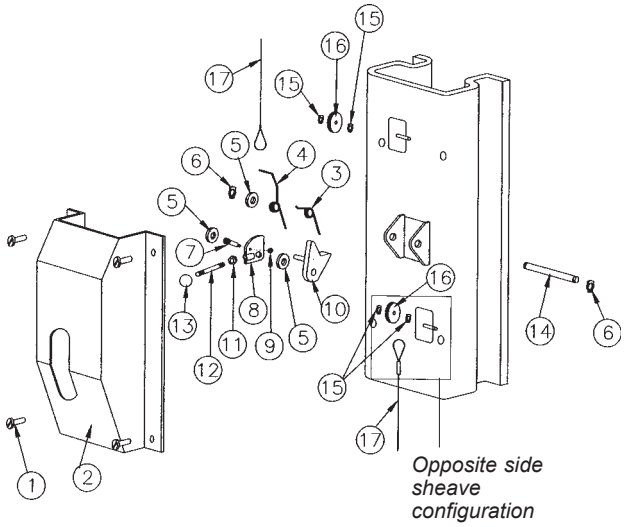

*Opposite side sheave configuration*

| Item | Part# | OEM # | Req | Description |
|---|---|---|---|---|
| 1 | F-MS-0312-18-0375 | | 4 | 5/16-18 x 3/8 Machine Screw |
| 2 | BH-7502-51 | FJ7452 | 1 | Main Side Cover (slotted) |
| | BH-7502-50 | FJ7451 | 1 | Opposite Side Cover (no slot) |
| 3 | BH-7503-16 | FJ7382-9 | 1 | Spring |
| 4 | BH-7503-31 | FJ7566-10 | 2 | Lock Latch Spring |
| 5 | BH-7500-49B | 41388 | 8 | 3/4" x 1-1/2" Bushing |
| 6 | BH-7500-62A | 41411 | 4 | Ext. Retaining Ring 5304-75 |
| 7 | F-SB-0250-20-1250 | | 2 | 1/4-20 X 1-1/4 Shoulder Bolt |
| 8 | BH-7503-13 | FJ7382-5 | 2 | Control Plate |
| 9 | F-LN-0250-20 | | 2 | 1/4-20 Lock Nut |
| 10 | BH-7528-01 | N165-1 | 2 | Lock Pawl |
| 11 | F-JN-0375-16 | | | 3/8-16 Jam Nut |
| 12 | BH-7503-17 | FJ7382-18 | 1 | Lock Release Handle |
| 13 | BH-7503-45 | FC134-91 | 1 | Red Ball |
| 14 | BH-7502-34 | FJ7382-34 | 2 | Lock Shaft |
| 15 | BH-7537-59B | 41410 | 4 | Ext. Retaining Ring 5304-37 |
| 16 | BH-7501-26 | FJ7322 | | Lock Cable Sheave |
| 17 | BH-7501-24 | FJ7595-1 | 1 | Locking Latch Release Cable |

All names, numbers, symbols and descriptions are used for reference purposes only. It is not implied that any part listed is the product of these manufacturers; however, some parts may be the actual product of these manufacturers.